Galaxy 3500

10-30 kVA 208/220 V

Single and Parallel Installation

06/2017





Legal Information

The Schneider Electric brand and any registered trademarks of Schneider Electric Industries SAS referred to in this guide are the sole property of Schneider Electric SA and its subsidiaries. They may not be used for any purpose without the owner's permission, given in writing. This guide and its content are protected, within the meaning of the French intellectual property code (Code de la propriété intellectuelle français, referred to hereafter as "the Code"), under the laws of copyright covering texts, drawings and models, as well as by trademark law. You agree not to reproduce, other than for your own personal, noncommercial use as defined in the Code, all or part of this guide on any medium whatsoever without Schneider Electric's permission, given in writing. You also agree not to establish any hypertext links to this guide or its content. Schneider Electric does not grant any right or license for the personal and noncommercial use of the guide or its content, except for a non-exclusive license to consult it on an "as is" basis, at your own risk. All other rights are reserved.

Electrical equipment should be installed, operated, serviced, and maintained only by qualified personnel. No responsibility is assumed by Schneider Electric for any consequences arising out of the use of this material.

As standards, specifications, and designs change from time to time, please ask for confirmation of the information given in this publication.

Table of Contents

Important Safety Instructions — SAVE THESE	
INSTRUCTIONS	5
FCC Statement	
Safety Precautions	6
Electrical Safety	8
Battery Safety	9
Product Specific Safety Information	10
Specifications	11
AC Input Specifications	11
AC Bypass Specifications	11
AC Output Specifications	12
Battery Specifications	12
Recommended Cable Sizes	12
Connection Terminals	13
Torque Specifications	13
Fuses and Breakers	13
Required Upstream Breaker Sizes in Single Systems	15
Fuse and Breaker Sizes in Parallel Systems	15
Minimum Breaker Settings 208 V	16
Mechanical Assembly	17
Clearance	17
Level the Cabinets	17
Remove the Front Panel	18
Floor Anchoring	19
Connect Floor Anchoring Brackets to the UPS and Modular Battery	
Cabinet for Stability	19
Hole Positions for Up to Four UPS Units in Parallel with U-Shaped	
Anchoring Brackets	
Remove the Modular Batteries from the UPS Cabinet(s)	21
Install the Baying Kit for Interconnection of Cabinets and Seismic	
Anchoring (Option)	23
Prepare for Cables	27
Bottom Cable Entry	27
Install Modular Battery Cabinets (Option)	29
Connect Battery Power in Installations with Busbars	29
Isolator Installation Principle	29
Install Busbars in 523 mm (20.59 in) UPS System with the UPS	
Placed to the Left	30
Install Busbars in 523 mm (20.59 in) UPS System with the UPS	
Placed to the Right	31
Install Busbars in 352 mm (13.85 in) UPS System with the UPS	
Placed to the Right	32
Install Busbars in 352 mm (13.85 in) UPS System with the UPS	
Placed to the Left	
Connect Battery Power in Installations with Cables	35
Connect Battery Cables Between the UPS and the Modular Battery	
Cabinet	35

Connect Battery Cables Between Two Modular Battery Cabinets	37
Connect the Power Cables to the UPS	39
Connect the Input, Bypass, and Output Cables	39
3:3 Single Mains	39
3:3 Dual Mains	40
Connect the Battery Cables to Third Party Batteries (if Applicable)	41
Connect the Communication Cables	42
Prepare for Communication Cables	42
Overview of the Pin Connections	43
Connect EPO in Single Systems	44
Connect EPO in Parallel Systems	45
Connect Communication Cables between UPS and Modular Battery	
Cabinet	46
Connect Schneider Electric Communication Options	47
Connect Communication Cables in Parallel System	48
Overview of the PBus Cables	48
Prepare for Cables	49
Install Seismic Option	54
Install the Seismic Battery Lock	54
Install the Seismic Stabilizing Brackets	54
Final Mechanical Installation	56
Install Batteries and Connect Battery Securing Brackets	56
Reinstall the Top Plate and the Front Panel	

Important Safety Instructions — SAVE THESE INSTRUCTIONS

Read these instructions carefully and look at the equipment to become familiar with it before trying to install, operate, service or maintain it. The following safety messages may appear throughout this manual or on the equipment to warn of potential hazards or to call attention to information that clarifies or simplifies a procedure.



The addition of this symbol to a "Danger" or "Warning" safety message indicates that an electrical hazard exists which will result in personal injury if the instructions are not followed.



This is the safety alert symbol. It is used to alert you to potential personal injury hazards. Obey all safety messages with this symbol to avoid possible injury or death.

ADANGER

DANGER indicates a hazardous situation which, if not avoided, **will result in** death or serious injury.

Failure to follow these instructions will result in death or serious injury.

AWARNING

WARNING indicates a hazardous situation which, if not avoided, **could result in** death or serious injury.

Failure to follow these instructions can result in death, serious injury, or equipment damage.

ACAUTION

CAUTION indicates a hazardous situation which, if not avoided, **could result in** minor or moderate injury.

Failure to follow these instructions can result in injury or equipment damage.

NOTICE

NOTICE is used to address practices not related to physical injury. The safety alert symbol shall not be used with this type of safety message.

Failure to follow these instructions can result in equipment damage.

Please Note

Electrical equipment should only be installed, operated, serviced, and maintained by qualified personnel. No responsibility is assumed by Schneider Electric for any consequences arising out of the use of this material.

A qualified person is one who has skills and knowledge related to the construction, installation, and operation of electrical equipment and has received safety training to recognize and avoid the hazards involved.

FCC Statement

NOTE: This equipment has been tested and found to comply with the limits for a Class A digital device, pursuant to Part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference when the equipment is operated in a commercial environment. This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instruction manual, may cause harmful interference to radio communications. Operation of this equipment in a residential area is likely to cause harmful interference in which case the user will be required to correct the interference at his own expense.

Any changes or modifications not expressly approved by the party responsible for compliance could void the user's authority to operate the equipment.

Safety Precautions

ADANGER

HAZARD OF ELECTRIC SHOCK, EXPLOSION, OR ARC FLASH

All safety instructions in this document must be read, understood and followed.

Failure to follow these instructions will result in death or serious injury.

ADANGER

HAZARD OF ELECTRIC SHOCK, EXPLOSION, OR ARC FLASH

Read all instructions in the Installation Manual before installing or working on this UPS system.

Failure to follow these instructions will result in death or serious injury.

ADANGER

HAZARD OF ELECTRIC SHOCK, EXPLOSION, OR ARC FLASH

Do not install the UPS system until all construction work has been completed and the installation room has been cleaned.

Failure to follow these instructions will result in death or serious injury.

HAZARD OF ELECTRIC SHOCK, EXPLOSION, OR ARC FLASH

- The product must be installed according to the specifications and requirements as defined by Schneider Electric. It concerns in particular the external and internal protections (upstream breakers, battery breakers, cabling, etc.) and environmental requirements. No responsibility is assumed by Schneider Electric if these requirements are not respected.
- After the UPS system has been electrically wired, do not start up the system. Start-up must only be performed by Schneider Electric.

Failure to follow these instructions will result in death or serious injury.

ADANGER

HAZARD OF ELECTRIC SHOCK, EXPLOSION, OR ARC FLASH

The UPS system must be installed according to local and national regulations. Install the UPS according to:

- IEC 60364 (including 60364–4–41- protection against electric shock, 60364–4–42 protection against thermal effect, and 60364–4–43 protection against overcurrent), or
- NEC NFPA 70, or
- Canadian Electrical Code (C22.1, Part 1)

depending on which one of the standards apply in your local area.

Failure to follow these instructions will result in death or serious injury.

A DANGER

HAZARD OF ELECTRIC SHOCK, EXPLOSION, OR ARC FLASH

- Install the UPS system in a temperature controlled indoor environment free of conductive contaminants and humidity.
- Install the UPS system on a non-flammable, level and solid surface (e.g. concrete) that can support the weight of the system.

Failure to follow these instructions will result in death or serious injury.

ADANGER

HAZARD OF ELECTRIC SHOCK, EXPLOSION, OR ARC FLASH

The UPS is not designed for and must therefore not be installed in the following unusual operating environments:

- Damaging fumes
- Explosive mixtures of dust or gases, corrosive gases, or conductive or radiant heat from other sources
- Moisture, abrasive dust, steam or in an excessively damp environment
- Fungus, insects, vermin
- Salt-laden air or contaminated cooling refrigerant
- Pollution degree higher than 2 according to IEC 60664-1
- Exposure to abnormal vibrations, shocks, and tilting
- · Exposure to direct sunlight, heat sources, or strong electromagnetic fields

Failure to follow these instructions will result in death or serious injury.

HAZARD OF ELECTRIC SHOCK, EXPLOSION, OR ARC FLASH

Do not drill or cut holes for cables or conduits with the gland plates installed and do not drill or cut holes in close proximity to the UPS.

Failure to follow these instructions will result in death or serious injury.

AWARNING

HAZARD OF ARC FLASH

Do not make mechanical changes to the product (including removal of cabinet parts or drilling/cutting of holes) that are not described in the Installation Manual.

Failure to follow these instructions can result in death, serious injury, or equipment damage.

NOTICE

RISK OF OVERHEATING

Respect the space requirements around the UPS system and do not cover the product's ventilation openings when the UPS system is in operation.

Failure to follow these instructions can result in equipment damage.

NOTICE

RISK OF EQUIPMENT DAMAGE

Do not connect the UPS output to regenerative load systems including photovoltaic systems and speed drives.

Failure to follow these instructions can result in equipment damage.

Electrical Safety

ADANGER

HAZARD OF ELECTRIC SHOCK, EXPLOSION OR ARC FLASH

- Electrical equipment must be installed, operated, serviced, and maintained only by qualified personnel.
- Apply appropriate personal protective equipment (PPE) and follow safe electrical work practices.
- Turn off all power supplying the UPS system before working on or inside the equipment.
- Before working on the UPS system, check for hazardous voltage between all terminals including the protective earth.
- The UPS contains an internal energy source. Hazardous voltage can be
 present even when disconnected from the utility/mains supply. Before
 installing or servicing the UPS system, ensure that the units are OFF and that
 utility/mains and batteries are disconnected. Wait five minutes before
 opening the UPS to allow the capacitors to discharge.
- A disconnection device (e.g. disconnection circuit breaker or switch) must be installed to enable isolation of the system from upstream power sources in accordance with local regulations. This disconnection device must be easily accessible and visible.
- The UPS must be properly earthed/grounded and due to a high leakage current, the earthing/grounding conductor must be connected first.

Failure to follow these instructions will result in death or serious injury.

HAZARD OF ELECTRIC SHOCK, EXPLOSION, OR ARC FLASH

In systems where backfeed protection is not part of the standard design, an automatic isolation device (backfeed protection option or other device meeting the requirements of IEC/EN 62040–1 **or** UL1778 4th Edition – depending on which of the two standards apply to your local area) must be installed to prevent hazardous voltage or energy at the input terminals of the isolation device. The device must open within 15 seconds after the upstream power supply fails and must be rated according to the specifications.

Failure to follow these instructions will result in death or serious injury.

When the UPS input is connected through external isolators that, when opened, isolate the neutral or when the automatic backfeed isolation is provided external to the equipment or is connected to an IT power distribution system, a label must be fitted at the UPS input terminals, and on all primary power isolators installed remote from the UPS area and on external access points between such isolators and the UPS, by the user, displaying the following text (or equivalent in a language which is acceptable in the country in which the UPS system is installed):

A DANGER

HAZARD OF ELECTRIC SHOCK, EXPLOSION, OR ARC FLASH

Risk of Voltage Backfeed. Before working on this circuit: Isolate the UPS and check for hazardous voltage between all terminals including the protective earth.

Failure to follow these instructions will result in death or serious injury.

Battery Safety

ADANGER

HAZARD OF ELECTRIC SHOCK, EXPLOSION, OR ARC FLASH

- Battery circuit breakers must be installed according to the specifications and requirements as defined by Schneider Electric.
- Servicing of batteries must only be performed or supervised by qualified personnel knowledgeable of batteries and the required precautions. Keep unqualified personnel away from batteries.
- Disconnect charging source prior to connecting or disconnecting battery terminals.
- Do not dispose of batteries in a fire as they can explode.
- Do not open, alter, or mutilate batteries. Released electrolyte is harmful to the skin and eyes. It may be toxic.

Failure to follow these instructions will result in death or serious injury.

HAZARD OF ELECTRIC SHOCK, EXPLOSION, OR ARC FLASH

Batteries can present a risk of electric shock and high short-circuit current. The following precautions must be observed when working on batteries

- Remove watches, rings, or other metal objects.
- Use tools with insulated handles.
- Wear protective glasses, gloves and boots.
- Do not lay tools or metal parts on top of batteries.
- Disconnect the charging source prior to connecting or disconnecting battery terminals.
- Determine if the battery is inadvertently grounded. If inadvertently grounded, remove source from ground. Contact with any part of a grounded battery can result in electric shock. The likelihood of such shock can be reduced if such grounds are removed during installation and maintenance (applicable to equipment and remote battery supplies not having a grounded supply circuit).

Failure to follow these instructions will result in death or serious injury.

ADANGER

HAZARD OF ELECTRIC SHOCK, EXPLOSION, OR ARC FLASH

When replacing batteries, always replace with the same type and number of batteries or battery packs.

Failure to follow these instructions will result in death or serious injury.

NOTICE

RISK OF EQUIPMENT DAMAGE

- Wait until the system is ready to be powered up before installing batteries in the system. The time duration from battery installation until the UPS system is powered up must not exceed 72 hours or 3 days.
- Batteries must not be stored more than six months due to the requirement of recharging. If the UPS system remains de-energized for a long period, Schneider Electric recommends that you energize the UPS system for a period of 24 hours at least once every month. This charges the batteries, thus avoiding irreversible damage.

Failure to follow these instructions can result in equipment damage.

Product Specific Safety Information

NOTE: The system is designed for connection to an IT power distribution system.

NOTE: The parallel cables must be run by the electrician but not attached. The field service engineer from Schneider Electric will install the parallel communication box and attach all cables to the UPS units.

NOTE: Up to four UPS units can run in parallel.

NOTE: Battery and utility/mains power must not be connected until all other wiring has been completed.

Specifications 10-30 kVA 208/220 V

Specifications

ADANGER

HAZARD OF ELECTRIC SHOCK, EXPLOSION OR ARC FLASH

The UPS must be supplied from a 208/120 V or 220/127 V 4W + GND 60 HZ source.

Failure to follow these instructions will result in death or serious injury.

AC Input Specifications

	10 kVA		15 kVA		20 kVA		30 kVA	
	208 V	220 V	208 V	220 V	208 V	220 V	208 V	220 V
Connection type	4-wire (3PH -	+ N + G)						
Voltage range (V)		5% at 100% lo 5% at < 50% lo						
Input frequency (Hz)	40-70							
THDI	< 5% at full lo	oad						
Nominal input current (A)	24.3	23.0	36.6	34.6	48.6	45.8	73.2	69.0
Maximum input current (A)	26.7	25.2	40.2	38.0	53.0	50.1	80.1	75.8
Input current limitation (A)	32.8	32.8	49.5	49.5	65.2	65.2	98.8	98.8
Input power factor correction	> 0.98 at load	> 0.98 at load > 50%						
Maximum input short circuit withstand (kA) Icc	Rated peak v	Rated conditional short–circuit current lcc: 30 kA Rated peak withstand current lpk: lcc x 1.7 Device: Refer to Required Upstream Breaker Sizes in Single Systems, page 15.						

AC Bypass Specifications

	10 kVA		15 kVA		20 kVA		30 kVA	
	208 V	220 V	208 V	220 V	208 V	220 V	208 V	220 V
Connection type	4-wire (3PH -	4-wire (3PH + N + G)						
Voltage range (V)	± 10%	± 10%						
Input frequency (Hz)	50 ± 10 or 60	± 10						
Nominal input current (A)	27.8	26.2	41.6	39.4	55.5	52.5	83.3	78.7
Maximum input short circuit withstand (kA) Icc	Rated peak v	Rated conditional short–circuit current lcc: 30 kA Rated peak withstand current lpk: lcc x 1.7 Device: Refer to Required Upstream Breaker Sizes in Single Systems, page 15.						

10-30 kVA 208/220 V Specifications

AC Output Specifications

	10 kVA		15 kVA	15 kVA			30 kVA	
	208 V	220 V	208 V	220 V	208 V	220 V	208 V	220 V
Connection type	4-wire (3PH -	+ N + G)						
Overload capacity	125% for 10 i 150% for 1 m 125% for 10 i 110% continu	150% for 1 minute (normal operation) 125% for 10 minutes (normal operation) 150% for 1 minute (battery operation) 125% for 10 minutes (battery operation) 110% continuous (bypass operation) 800% for 500 ms (bypass operation)						
Nominal output current (A)	27.8	26.2	41.6	39.4	55.5	52.5	83.3	78.7
Output frequency (sync to mains)		z, ±3 Hz, ±10 ł z, ±3 Hz, ±10 ł				•		
Slew rate (Hz/Sec)	0.25-1							
THDU	< 1.5% linear < 3.5% non-li							
Load power factor	0.5 leading to	0.5 lagging						
Dynamic load response	± 5%	± 5%						
Output voltage regulation	± 1%							

Battery Specifications

Туре	VRLA
Nominal voltage (VDC)	+/- 192
Float voltage (VDC)	+/- 219
End of discharge voltage (VDC)	+/- 154
Battery current (at full load)	66.5 A at +/-192 V
Maximal current (at end of discharge)	83.2 A at + 154 V
Maximal charging power	10 kVA: 1600 W 15 kVA: 2400 W 20 kVA: 3200 W 30 kVA: 3200 W
Typical recharge time	5 hours
End voltage	1.6-1.75 V/cell (automatic, depending on load)

Recommended Cable Sizes

ADANGER

HAZARD OF ELECTRIC SHOCK, EXPLOSION, OR ARC FLASH

At 100% switch mode load, the neutral must be rated for 200% phase current.

Failure to follow these instructions will result in death or serious injury.

Specifications 10-30 kVA 208/220 V

ADANGER

HAZARD OF ELECTRIC SHOCK, EXPLOSION, OR ARC FLASH

All wiring must comply with all applicable national and/or electrical code.

Failure to follow these instructions will result in death or serious injury.

NOTE: The recommended cable sizes are based on an environment with an ambient temperature of 30° C (86° F). Use stranded copper cables.

	10 kVA	15 kVA	20 kVA	30 kVA
Utility/mains input	8 AWG	6 AWG	4 AWG	1 AWG
Static bypass input	8 AWG	6 AWG	4 AWG	1 AWG
DC input	1 AWG	1 AWG	1 AWG	1 AWG
Output	8 AWG	6 AWG	4 AWG	1 AWG

Connection Terminals

Cable size (AWG)	Cable lug type	Crimping tool	Die	Terminal bolt diameter
12	YA12CL2TC38	MD7-34R	W12CVT	6 mm (0.2 in)
8	YA8CL2TC38	MD7-34R	W8CVT	6 mm (0.2 in)
6	YA6CL2TC38	MD7-34R	W6CVT	6 mm (0.2 in)
4	YA4CL2TC38	MD7-34R	W4CVT	6 mm (0.2 in)
1	YA1CL2TC38	MD7-34R	W1CVT	6 mm (0.2 in)

Torque Specifications

The power wiring should be torqued to 7 Nm (45 lbf-in).


Fuses and Breakers

NOTE: For installations with a Schneider Electric maintenance bypass panel, refer to the installation manual provided with the maintenance bypass panel for wiring diagrams.

10-30 kVA 208/220 V Specifications

Single Utility/Mains System


- Q1: Utility/mains input Q2: UPS output
- Q3: Manual bypass
- MBS: Mechanical bypass switch

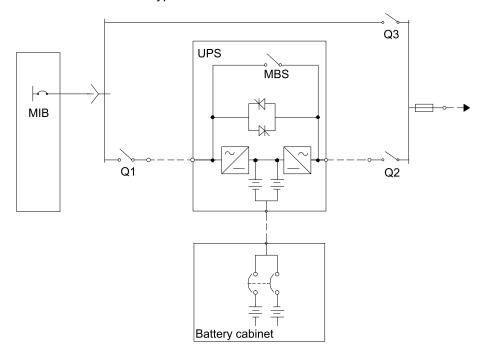

Dual Utility/Mains System

- Q1: Utility/mains input Q2: UPS output

- Q3: Manual bypass Q5: Static bypass input
- MBS: Mechanical bypass switch

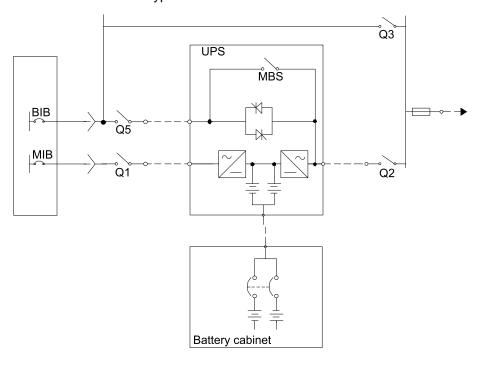


Parallel System

Q1: Utility/mains input Q2: UPS output

14 990-1957G-001 Specifications 10-30 kVA 208/220 V

- Q3: Manual bypass
 Q4: System output
- Q5: Static bypass input

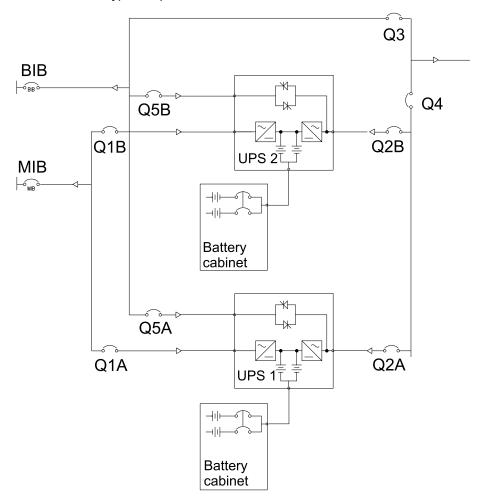

Required Upstream Breaker Sizes in Single Systems

NOTE: The specified upstream breakers below are required to obtain the conditional short circuit current rating, Icc at 30 kA symmetrical rms.

	10 kVA	15 kVA	20 kVA	30 kVA
Input Q1	80% rated circuit breaker, HGL36035, rating 35 A	80% rated circuit breaker, HGL36060, rating 60 A	80% rated circuit breaker, HGL36080, rating 80 A	80% rated circuit breaker, HGL360110, rating 110 A
Bypass Q5	80% rated circuit breaker, HGL36035, rating 35 A	80% rated circuit breaker, HGL36060, rating 60 A	80% rated circuit breaker, HGL36080, rating 80 A	80% rated circuit breaker, HGL360110, rating 110 A
Output Q2 (A)	35	60	80	110
Manual bypass Q3 (A)	35	60	80	110

Fuse and Breaker Sizes in Parallel Systems

Q3 and Q4 in Parallel Capacity Systems

Units in parallel	10 kVA	15 kVA	20 kVA	30 kVA
2 (A)	70	110	150	225
3 (A)	110	175	225	350
4 (A)	150	225	300	450

10-30 kVA 208/220 V Specifications

Q3 and Q4 in Redundant Parallel Systems (n+1)

Units in parallel	10 kVA	15 kVA	20 kVA	30 kVA
2 (A)	35	60	80	110
3 (A)	70	110	150	225
4 (A)	110	175	225	350

Minimum Breaker Settings 208 V

		800% overload bypass operation	150% overload normal/battery operation	125% overload normal/battery operation	Continuously
	Duration	500 ms	60 s	10 min	
10 kVA	Input (A)	_1	-	-	34
	Bypass (A)	223	-	-	31
	Output (A)	223	42	35	31
15 kVA	Input (A)	_1	-	-	51
	Bypass (A)	333	-	-	46
	Output (A)	333	63 A	52	46
20 kVA	Input (A)	_1	-	-	68
	Bypass (A)	444	-	-	62
	Output (A)	444	84	70	62
30 kVA	Input (A)	-1	-	-	99
	Bypass (A)	667	-	-	92
	Output (A)	667	125	105	92


^{1.} For single mains systems, use the higher value of input and static bypass

Mechanical Assembly 10-30 kVA 208/220 V

Mechanical Assembly

Clearance

NOTE: Clearance dimensions are published for airflow and service access only. Consult with the local safety codes and standards for additional requirements in your local area.

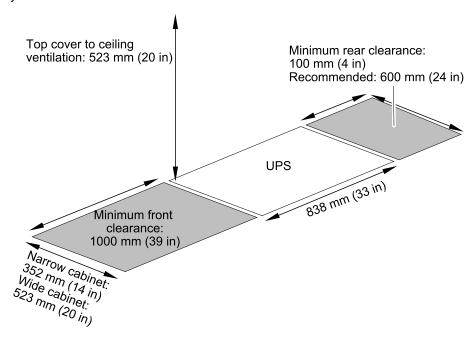

Level the Cabinets


AWARNING

TIP HAZARD

The system must be installed on a level floor. The leveling feet will stabilize the cabinet, but will not compensate for a badly sloped floor.


Failure to follow these instructions can result in death, serious injury, or equipment damage.

1. Use a screwdriver to lower the four leveling feet

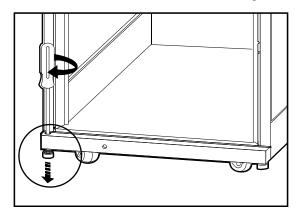

10-30 kVA 208/220 V Mechanical Assembly

2. Use a wrench to adjust the four leveling feet and ensure that the cabinet is level.

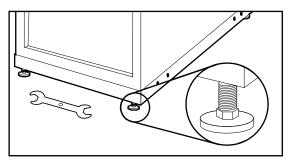


AWARNING

TIP HAZARD

Do not move the cabinet after the leveling feet have been lowered.


Failure to follow these instructions can result in death, serious injury, or equipment damage.

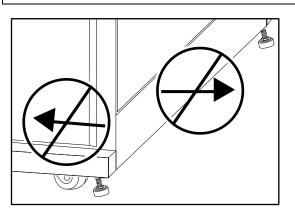

Remove the Front Panel

- 1. Use a coin or similar to turn the two black lock devices on either side of the display in the direction of each other to a vertical position.
- 2. Push the front panel upwards and pull it outwards to disengage the locking device at the top of the cabinet.

Mechanical Assembly 10-30 kVA 208/220 V

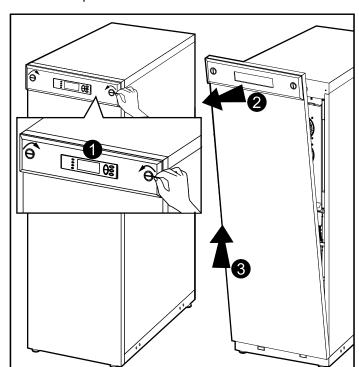

3. Lift the front panel free of the two slots at the bottom of the cabinet.

Floor Anchoring

Two floor anchoring options are available depending on the requirements in the installation area:

- For stability: Reuse the L-shaped brackets that held the cabinet to the pallet during shipment for a stand-alone UPS.
- For seismic anchoring: Use a baying kit that includes U-shaped seismic anchoring brackets.

NOTE: Allow for enough working space behind the cabinet for electrical work to be carried out (e.g. if you want to install a modular battery cabinet at a later stage).

NOTE: Hole positions are guidelines only.


Connect Floor Anchoring Brackets to the UPS and Modular Battery Cabinet for Stability

NOTE: Floor anchoring bolts are not provided with the UPS. Purchase the bolts locally (minimum size: M8). Follow the specifications given by the manufacturer of the floor anchoring system when bolting the UPS system to the floor.

NOTE: Recommended minimum number of screws per cabinet for the L-shaped brackets is four; one in each corner. Recommended floor bolt size: M8.


10-30 kVA 208/220 V Mechanical Assembly

Hole Positions for a Stand-alone UPS Cabinet with L-Shaped Anchoring Brackets – Narrow UPS 352 mm (13.85 in) and Wide UPS 523 mm (20.59 in)

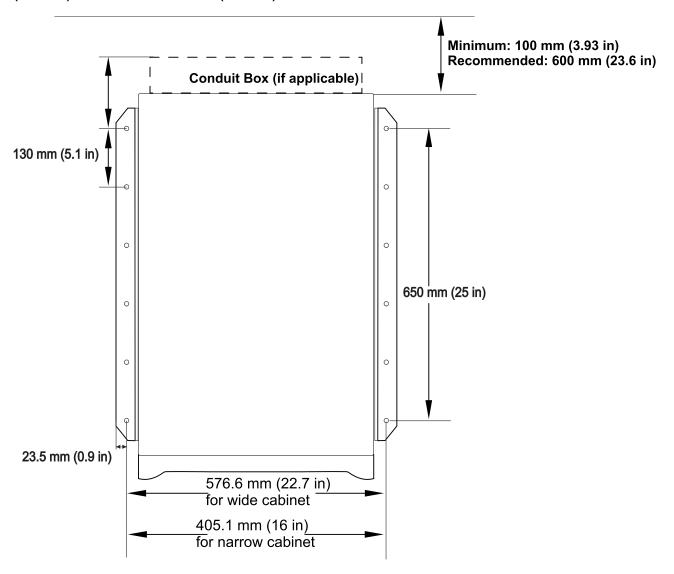

- 1. Install the L-shaped floor anchoring brackets (reuse the two transport brackets) and secure with the M6 screws and nuts (provided).
- 2. Drill two to six holes in the floor for each bracket and attach these with bolts.

Side view

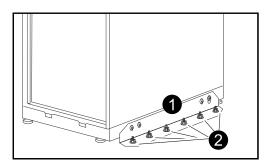


Hole Positions for Up to Four UPS Units in Parallel with U-Shaped Anchoring Brackets


NOTE: Recommended minimum number of floor screws for the two configurations below is 10.

Mechanical Assembly 10-30 kVA 208/220 V

Narrow UPS 352 mm (13.85 in)

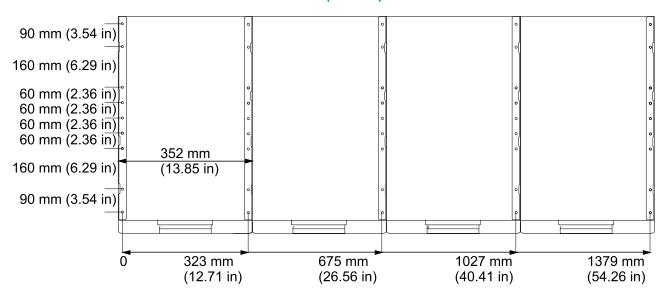

Wide UPS 523 mm (20.59 in)

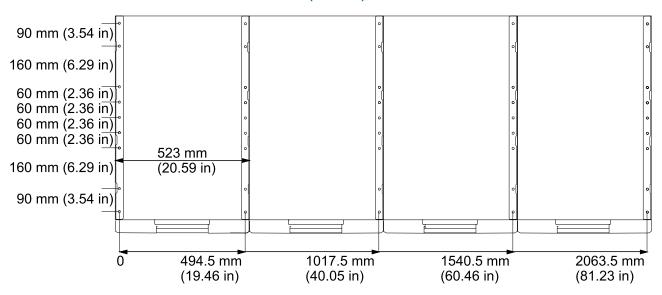

Remove the Modular Batteries from the UPS Cabinet(s)

ADANGER

HAZARD OF ELECTRIC SHOCK, EXPLOSION OR ARC FLASH

- Battery circuit breakers must be installed according to the specifications and requirements as defined by Schneider Electric.
- Servicing of batteries must only be performed or supervised by qualified personnel knowledgeable of batteries and the required precautions. Keep unqualified personnel away from batteries.
- Disconnect charging source prior to connecting or disconnecting battery terminals.
- Do not dispose of batteries in a fire as they can explode.
- Do not open, alter, or mutilate batteries. Released electrolyte is harmful to the skin and eyes. It may be toxic.

Failure to follow these instructions will result in death or serious injury.

10-30 kVA 208/220 V Mechanical Assembly

A DANGER

HAZARD OF ELECTRIC SHOCK, EXPLOSION, OR ARC FLASH

Batteries can present a risk of electric shock and high short-circuit current. The following precautions must be observed when working on batteries

- Remove watches, rings, or other metal objects.
- · Use tools with insulated handles.
- · Wear protective glasses, gloves and boots.
- · Do not lay tools or metal parts on top of batteries.
- Disconnect the charging source prior to connecting or disconnecting battery terminals.
- Determine if the battery is inadvertently grounded. If inadvertently grounded, remove source from ground. Contact with any part of a grounded battery can result in electric shock. The likelihood of such shock can be reduced if such grounds are removed during installation and maintenance (applicable to equipment and remote battery supplies not having a grounded supply circuit).

Failure to follow these instructions will result in death or serious injury.


ACAUTION

HAZARD OF PERSONAL INJURY

Two persons are required for lifting a modular battery module.

Failure to follow these instructions can result in injury or equipment damage.

NOTE: When you remove modular batteries, start from the highest row and work your way down.

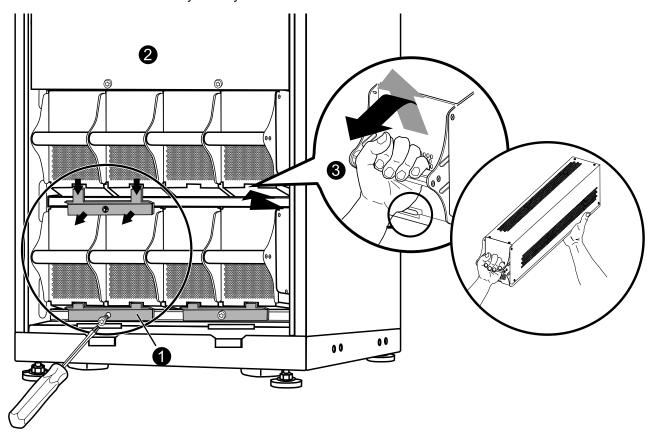

1. Remove all battery securing brackets (used to secure the batteries during transport) by removing the M6 Torx screws.

Mechanical Assembly 10-30 kVA 208/220 V

- 2. Remove the blind plate.
- 3. To release the battery from its lock mechanism, gently push the modular battery upwards and then pull it out while supporting the modular battery with your other hand.

Install the Baying Kit for Interconnection of Cabinets and Seismic Anchoring (Option)

AWARNING


HAZARD OF TILTING

Baying kits are required in seismic areas to prevent the cabinets from tilting during seismic events.

Failure to follow these instructions can result in death, serious injury, or equipment damage.


NOTE: Drill the floor holes according to your configuration as shown in *Hole Positions for Up to Four UPS Units in Parallel with U-Shaped Anchoring Brackets*, page 20.

1. Remove the side panels from the cabinet(s) to get access to the holes in the bottom frame.

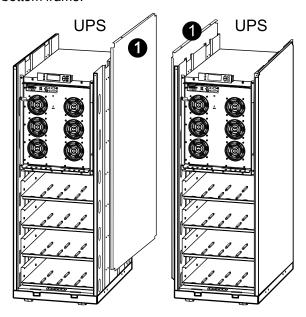

NOTE: Make sure that the cabinets are level so that they can be anchored to each other.


2. Position two U-shaped floor anchoring brackets under one cabinet; one on each side.

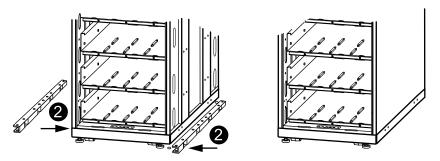


NOTE: The U-shaped anchoring brackets are 1-2 mm higher than the opening below the cabinet to disengage the casters. Therefore, the cabinet must be tilted when placing the U-shaped anchoring brackets under the cabinet.

10-30 kVA 208/220 V Mechanical Assembly

3. On each side of the same cabinet insert a maximum of nine and a minimum of two M8 screws (not provided) through holes in the bottom of the cabinet and through holes in the U-shaped floor anchoring brackets, and into the predrilled floor holes.

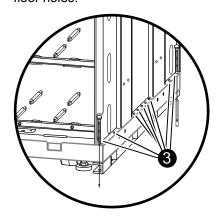

4. Fasten the screws.

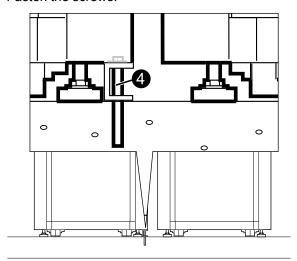

5. Move the adjacent cabinet on its casters close to the cabinet with the U-shaped floor anchoring brackets.

ACAUTION


RISK OF EQUIPMENT DAMAGE

If the adjacent cabinet is on its leveling feet, use a forklift or pallet jack to move it into position to avoid damaging the leveling feet.


Failure to follow these instructions can result in injury or equipment damage.

Mechanical Assembly 10-30 kVA 208/220 V

6. Insert the interconnection plates between the two cabinets. One is positioned toward the front and the other toward the rear. Notice how the "wings" on the interconnection plates rest in slots at the top of the inner panel.

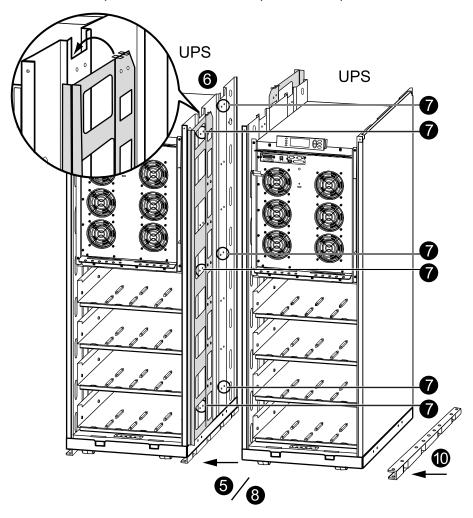

- 7. Align the two cabinets and level the three marked rows of bolt holes in UPS 1 with the holes in UPS 2.
- 8. Push the two cabinets firmly together.
- 9. Bolt the two cabinets together using the six M6x25 mm screws and nuts supplied in the kit; join one hole at the front and one hole at the rear of the cabinets on three levels.

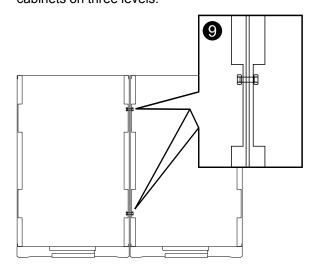

10-30 kVA 208/220 V Mechanical Assembly

10. Position the third U-shaped floor anchoring bracket under the adjacent cabinet (see previous graphics) and insert a minimum of two floor anchoring M8 screws (not provided) through the holes in the bottom of the cabinet and through the holes in the U-shaped floor anchoring bracket, and into the predrilled floor holes, and then fasten the screws.

Prepare for Cables 10-30 kVA 208/220 V

Prepare for Cables

Bottom Cable Entry


ADANGER

HAZARD OF ELECTRIC SHOCK, EXPLOSION OR ARC FLASH

Before carrying out the steps below, the system must be in total power off and the batteries must be removed.

Failure to follow these instructions will result in death or serious injury.


- From the rear of the UPS and modular battery cabinets, loosen the six M4 screws from the upper cover plate (the cable landing area) on the UPS and the modular battery cabinet, and remove. Save the screws for later use
- In installations with busbar connections, remove the screws from the bottom plate on the UPS and the modular battery cabinet(s) and then remove the plates.
- 3. Punch holes in the bottom of the conduit boxes to fit the size of the conduit pipes.
- 4. Attach the bottom part of the conduit boxes to the back of the UPS and the modular battery cabinet with four M4 screws each (if applicable).

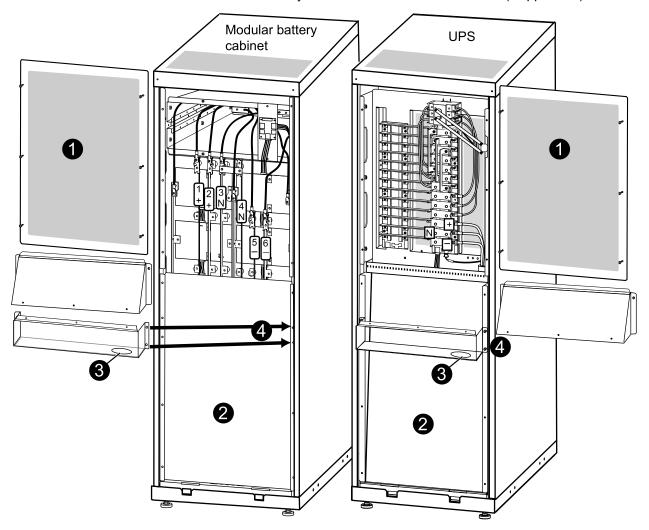

5. Attach conduits to the conduit box.

10-30 kVA 208/220 V Prepare for Cables

- 6. Run the cables through the conduits, through the bottom of the conduit box, and up into the cable landing area.
- 7. Attach the conduit box tops to the conduit box bottoms (two or three M4 screws depending on cabinet size) and to the cabinets (two M4 screws).
- 8. Fasten the cables with cable ties.

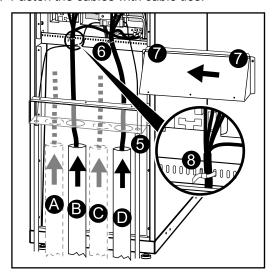

- A. Bypass cables
- B. Output cables
- C. Battery cables
- D. Input cables

Install Modular Battery Cabinets (Option)

Connect Battery Power in Installations with Busbars

ADANGER

HAZARD OF ELECTRIC SHOCK, EXPLOSION OR ARC FLASH


Before carrying out the steps below, the system must be in total power off and the batteries must be removed.

Failure to follow these instructions will result in death or serious injury.


Isolator Installation Principle

The isolators separate the baying kit busbar from the six vertical busbars in each modular battery cabinet, and the (+), N, and (-) busbars in the UPS.

1. Guide the busbar with isolator through the adjacent side panels.

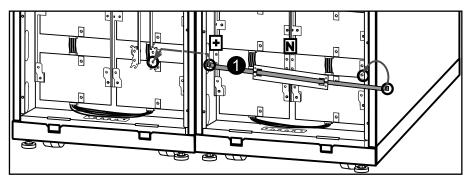


- 2. Position the isolators across the vertical busbars (N in this example) and then fasten the isolator busbar by using the provided M5 Torx screws.
- 3. Secure the isolator to its busbar with cable ties.

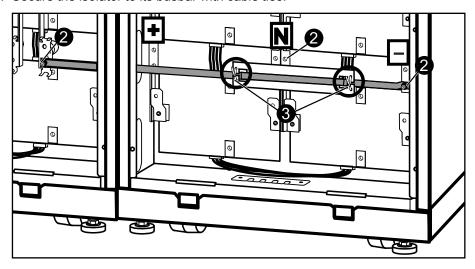

Install Busbars in 523 mm (20.59 in) UPS System with the UPS Placed to the Left


Front view

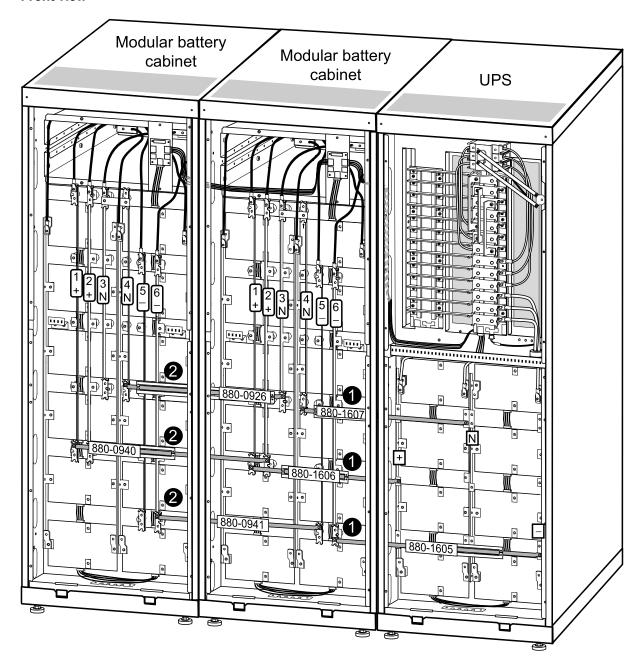

- 1. Install the following baying kit busbars between the UPS and modular battery cabinet 1:
 - 880-1607 between vertical busbar N on the UPS and busbar 4 on modular battery cabinet 1
 - 880-1606 between vertical busbar (+) on the UPS and busbar 1 on modular battery cabinet 1
 - 880-1605 between busbar (-) on the UPS and busbar 6 on modular battery cabinet 1
- 2. Install the following baying kit busbars between the two modular battery cabinets:
 - 880-0926 between vertical busbar 3 on modular battery cabinet 1 and busbar 4 on modular battery cabinet 2
 - 880-0940 between vertical busbar 2 on modular battery cabinet 1 and busbar 1 on modular battery cabinet 2
 - 880-0941 between vertical busbar 5 on modular battery cabinet 1 and busbar 6 on modular battery cabinet 2

Install Busbars in 523 mm (20.59 in) UPS System with the UPS Placed to the Right


Front view

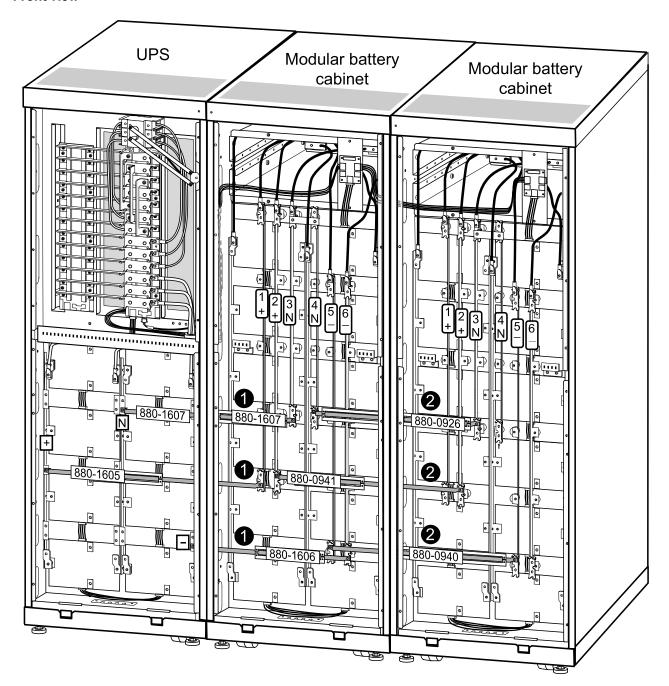

- 1. Install the following baying kit busbars between the UPS and modular battery cabinet 1:
 - 880-1607 between vertical busbar N on the UPS and busbar 3 on modular battery cabinet 1
 - 880-1605 between vertical busbar (+) on the UPS and busbar 1 on modular battery cabinet 1
 - 880-1606 between vertical busbar (-) on the UPS and busbar 6 on modular battery cabinet 1
- 2. Install the following baying kit busbars between the two modular battery cabinets:
 - 880-0926 between vertical busbar 4 on modular battery cabinet 1 and vertical busbar 3 on modular battery cabinet 2
 - 880-0941 between vertical busbar 2 on modular battery cabinet 1 and vertical busbar 2 on modular battery cabinet 2
 - 880-0940 between vertical busbar 5 on modular battery cabinet 1 and vertical busbar 5 on modular battery cabinet 2

Install Busbars in 352 mm (13.85 in) UPS System with the UPS Placed to the Right


Front view

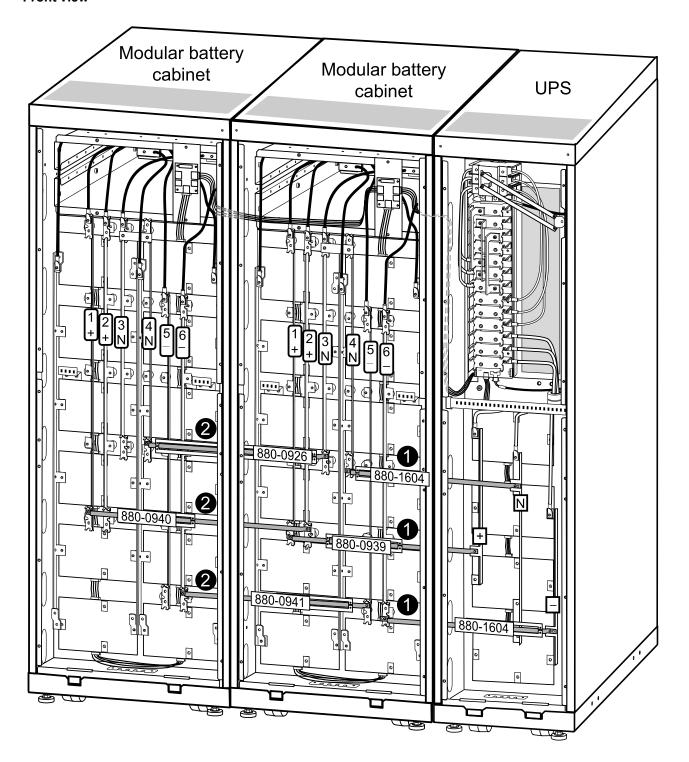

- 1. Install the following baying kit busbars between the UPS and modular battery cabinet 1:
 - 880-1604 between vertical busbar N on the UPS and busbar 4 on modular battery cabinet 1
 - 880-0939 between vertical busbar (+) on the UPS and busbar 1 on modular battery cabinet 1
 - 880-1604 between vertical busbar (-) on the UPS and busbar 6 on modular battery cabinet 1
- 2. Install the following baying kit busbars between two modular battery cabinets:
 - 880-0926 between vertical busbar 3 on modular battery cabinet 1 and busbar 4 on modular battery cabinet 2
 - 880-0940 between vertical busbar 2 on modular battery cabinet 1 and busbar 1 on modular battery cabinet 2
 - 880-0941 between vertical busbar 5 on modular battery cabinet 1 and busbar 6 on modular battery cabinet 2

Install Busbars in 352 mm (13.85 in) UPS System with the UPS Placed to the Left

Front view

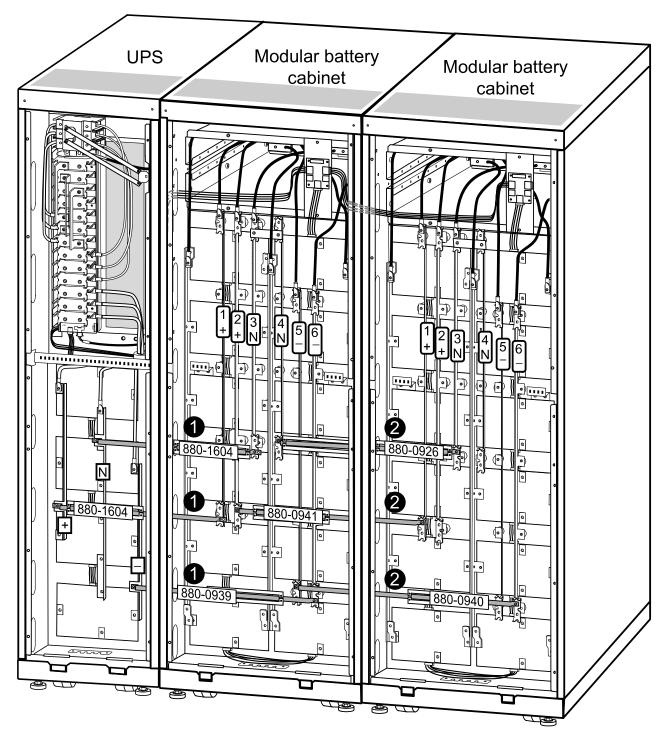

- 1. Install the following baying kit busbars between the UPS and modular battery cabinet 1:
 - 880-1604 between vertical busbar N on the UPS and busbar 3 on modular battery cabinet 1
 - 880-1604 between vertical busbar (+) on the UPS and busbar 1 on modular battery cabinet 1
 - 880-0939 between vertical busbar (-) on the UPS and busbar 6 on modular battery cabinet 1

- 2. Install the following baying kit busbars between two modular battery cabinets:
 - 880-0926 between vertical busbar 4 on modular battery cabinet 1 and vertical busbar 3 on modular battery cabinet 2
 - 880-0941 between vertical busbar 2 on modular battery cabinet 1 and vertical busbar 1 on modular battery cabinet 2
 - 880-0940 between vertical busbar 5 on modular battery cabinet 1 and vertical busbar 6 on modular battery cabinet 2

Connect Battery Power in Installations with Cables

Connect Battery Cables Between the UPS and the Modular Battery Cabinet

ADANGER

HAZARD OF ELECTRIC SHOCK, EXPLOSION OR ARC FLASH

Before carrying out the steps below, the system must be in total power off and the batteries must be removed.

Failure to follow these instructions will result in death or serious injury.


ADANGER

HAZARD OF ELECTRIC SHOCK, EXPLOSION OR ARC FLASH

Each stand-alone cabinet must be separately connected to the equipotential bonding system (protective earthing).

Failure to follow these instructions will result in death or serious injury.

NOTE: The terminals are only suitable for connection of copper cables (not supplied).

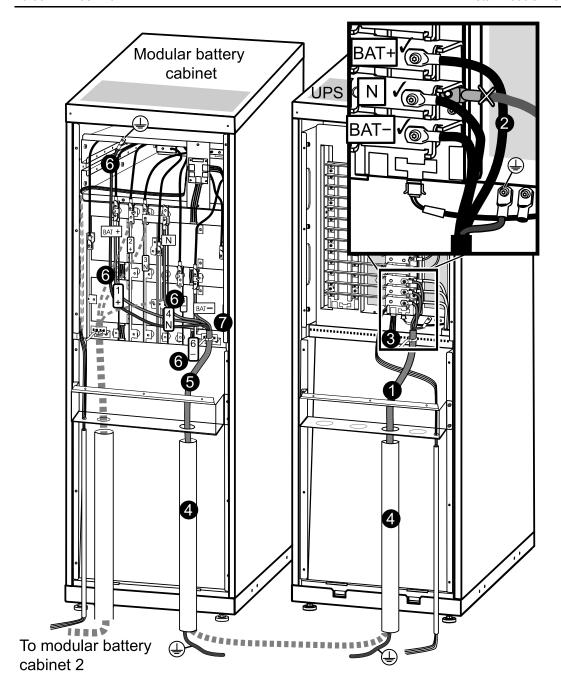

- 1. In the UPS, feed the battery cables up through the conduit box or through the transparent cable route bracket (not shown).
- 2. Connect the BAT+, BAT-, N, and ground cables to the outer part of the busbars in the UPS as shown.
- 3. Fasten the battery cables to the perforated bracket with cable ties.
- 4. Equip the battery cables with conduits (if applicable).
- 5. In the modular battery cabinet, feed the battery cables up through the conduit box (if applicable) to the cable landing area.
- 6. Connect the (+) cable to busbar number 1 (+), connect the N cable to busbar number 4 (N), the (-) cable to busbar number 6 (-), and the ground cable to the terminal in the top of the cabinet. Bundle the battery cables using the supplied cable ties.
- 7. Fasten the battery cables to the perforated bracket with cable ties.
- 8. Attach the top part of the conduit box (if applicable).

Connect Battery Cables Between Two Modular Battery Cabinets

ADANGER

HAZARD OF ELECTRIC SHOCK, EXPLOSION OR ARC FLASH

Before carrying out the steps below, the system must be in total power off and the batteries must be removed.

Failure to follow these instructions will result in death or serious injury.

ADANGER


HAZARD OF ELECTRIC SHOCK, EXPLOSION OR ARC FLASH

Each stand-alone cabinet must be separately connected to the equipotential bonding system (protective earthing).

Failure to follow these instructions will result in death or serious injury.

NOTE: The terminals are only suitable for connection of copper cables (not supplied).

Rear view

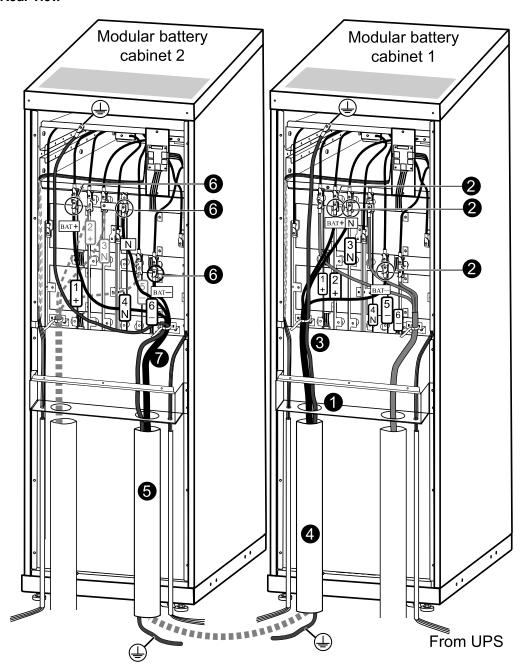

- Feed the battery cables up through the conduit box on modular battery cabinet
 1 or through the transparent cable route bracket (not shown) to the cable
 connection area.
- 2. Connect the (-) cable to busbar number 5 (-), the N cable to busbar number 3 (N), the (+) cable to busbar number 2 (+) in modular battery cabinet 1, and the ground cable to the terminal in the top of the cabinet.
- 3. Fasten the battery cables to the perforated bracket with cable ties.
- 4. Equip the battery cables with conduits (if applicable).
- 5. Feed the battery cables up into the conduit box on modular battery cabinet 2.
- 6. Connect the (-) cable to busbar number 6 (-), the N cable to busbar number 4 (N), and the (+) cable to busbar number 1 (+) in modular battery cabinet 2, and the ground cable to the terminal in the top of the cabinet. Bundle the battery cables using the supplied cable ties.
- 7. Fasten the battery cables to the perforated bracket with cable ties.
- 8. Attach the top part of the conduit box (if applicable).

Connect the Power Cables to the UPS

Connect the Input, Bypass, and Output Cables

▲ DANGER

HAZARD OF ELECTRIC SHOCK, EXPLOSION AND ARC FLASH

Use ONLY compression type lugs. Do not loosen or add cables to any factory preinstalled cables on busbars. Use the outer part of the busbar for connection only.

Failure to follow these instructions will result in death or serious injury.

NOTE: The terminals are only suitable for connection of copper cables.

NOTE: If 3—wiring is required, do not connect the neutral to the input cable landings and the output cable landings.

3:3 Single Mains

ADANGER


HAZARD OF ELECTRIC SHOCK, EXPLOSION, OR ARC FLASH

Connect only cables to the outer part of the busbars, never to the inner part of the busbars, as shown on illustration.

Failure to follow these instructions will result in death or serious injury.

- 1. Connect the AC input cables and the neutral to the input cable landings.
- 2. Connect the AC output cables and the neutral to the output cable landings.
- 3. Connect the ground cables to the studs (earth symbol beneath) using a screw.

Rear View of the UPS Cabinet

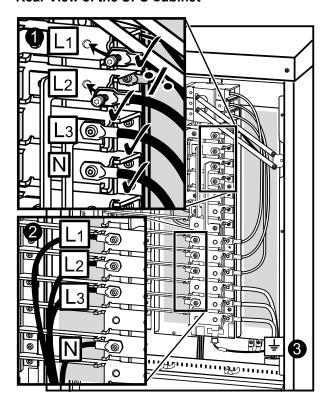

3:3 Dual Mains

▲ DANGER


HAZARD OF ELECTRIC SHOCK, EXPLOSION, OR ARC FLASH

Connect only cables to the outer part of the busbars, never to the inner part of the busbars, as shown on illustration.

Failure to follow these instructions will result in death or serious injury.


 Remove the three busbars A, B, and C by removing two M6 screws from each busbar.

Rear View of the UPS Cabinet

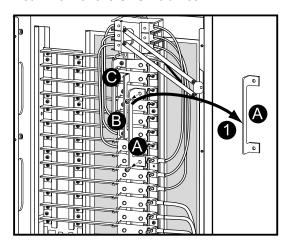

- 2. Connect the AC input cables and the neutral to the input cable landings.
- 3. Connect the bypass cables and the neutral to the bypass cable landings.
- 4. Connect the output cables and the neutral to the output cable landings.
- 5. Connect the ground cables to the studs (earth symbol beneath) using a screw.

Rear view

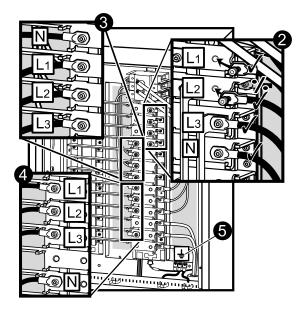

Connect the Battery Cables to Third Party Batteries (if Applicable)

ADANGER


HAZARD OF ELECTRIC SHOCK, EXPLOSION, OR ARC FLASH

Connect only cables to the outer part of the busbars, never to the inner part of the busbars, as shown on illustration.

Failure to follow these instructions will result in death or serious injury.

1. Connect the battery cables BAT+, BAT-, and N to the battery cable landings. Bundle the battery cables using the supplied cable ties.

Rear View of the UPS Cabinet

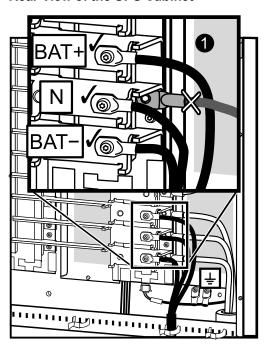

Connect the Communication Cables

Prepare for Communication Cables


ADANGER

HAZARD OF ELECTRIC SHOCK, EXPLOSION OR ARC FLASH

Make sure that the UPS is completely OFF as the connectors are very close to the power busbars.

Failure to follow these instructions will result in death or serious injury.

NOTE: Before connecting the communication cables, place the two supplied ferrites over the communication cables. Run the cable three times through the ferrite to reduce noise.

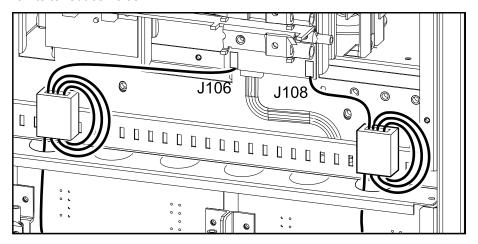

Overview of the Pin Connections


Rear view

J108 pin connections:

- 1. Normally open EPO
- 2. Normally open EPO return
- 3. Normally closed EPO
- 4. Normaly closed EPO return
- 5. +24 V SELV supply
- 6. SELV ground

J106 pin connections:

- 1. Battery measurement return²
- 2. Max. battery temperature²
- 3. Battery unit quantity²
- 4. Battery measurement supply²
- 5. Q3 active
- 6. Q3 active return
- 7. External control of charging
- 8. Ext. charging control return

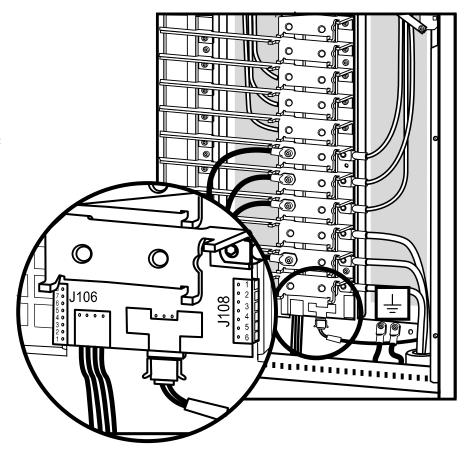

J106

Pins 1 to 4 are for battery measurement (only applicable to Galaxy 3500 modular battery cabinets).

Pins 5 and 6 are for external maintenance bypass Q3 (auxiliary switch N/C type). When Q3 is closed, signals are fed back to the UPS controller.

Pins 7 and 8 are for external charge control. When 7 and 8 are closed, the UPS charges batteries with a predefined percentage (0–25–50–75–100%) of the maximum charging power. To be used in generator applications, or if special codes require control of charging. When Q3 is closed, signals are fed back to the UPS controller.


^{2.} Should be used with Schneider Electric modular battery cabinets

Connect EPO in Single Systems


- Use only 1-1½ mm² copper wire for the connection of the EPO (Emergency Power Off) and other optional equipment.
- The UPS must be connected to either a dry contact or a 24 VDC EPO switch.

The external EPO +24 VDC, 1500 mA circuit can be supplied through other vendors.


- 1. Connect the EPO cable using one of the following four wiring configurations:
 - Dry Contacts Normally Open: EPO is activated when pin 1 is connected to pins 3 and 5. Connections: 2-4-6, 3-5, and 1.

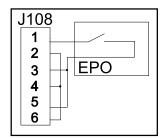


 +24 V Normally Open: EPO is activated when an isolated SELV 24 VDC voltage is supplied on pin 1 with reference to pin 2. Connections: 3-5 and 4-6.

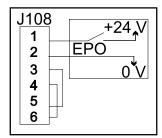

 Dry Contacts Normally Closed: EPO is activated when a connection from pin 3 to 5 is opened. Connections: 4-6.

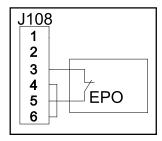

 +24 V Normally Closed: EPO is activated when a SELV 24 VDC voltage is removed from pin 3 with reference to pin 4.

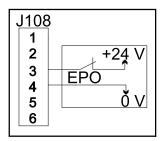

Connect EPO in Parallel Systems

In parallel systems each UPS unit must have a separate dry contact (voltage free) external to the UPS connected to J108.

ACAUTION


RISK OF ERRATIC UPS BEHAVIOR

For parallel and separate systems with common EPO, each UPS unit must be connected to a separate dry contact external to the UPS, because parallel EPO wiring between more UPS units can result in erratic UPS behavior.


Failure to follow these instructions can result in injury or equipment damage.

Schneider Electric recommends a **Dry Contacts Normally Closed EPO** installation of the UPS units in parallel – shown in the illustration below for four UPSs in parallel. Each UPS is connected to a separate dry contactor.

Dry Contacts Normally Closed EPO installation

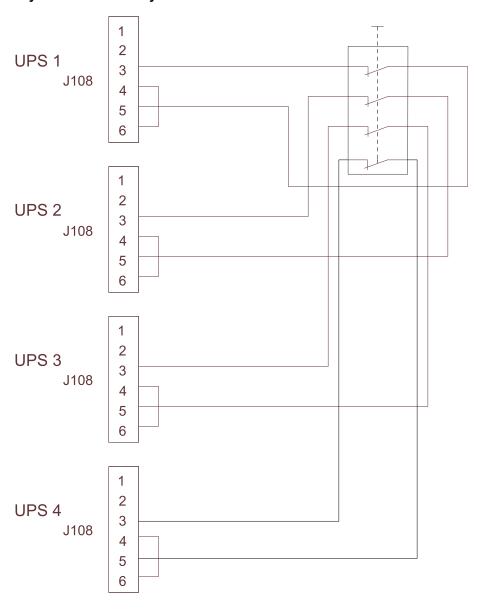

Connect Communication Cables between UPS and Modular Battery Cabinet

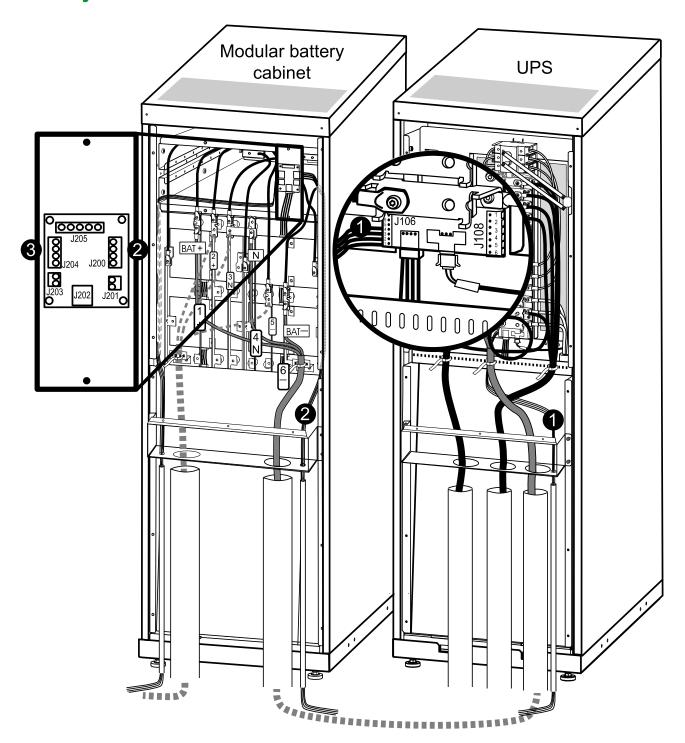

- 1. Feed the communication cable from pin connection J106 in the UPS down through the conduit (if applicable).
- 2. Run the communication cable up into the modular battery cabinet conduit and connect it to pin connection J200.
- 3. If you use a second modular battery cabinet, run the communication cable from pin connection J204 in modular battery cabinet 1 to pin connection J200 in modular battery cabinet 2.


Connect Schneider Electric Communication Options

NOTE: The cable routing of the power chute software and the temperature sensor is identical.

NOTE: The temperature sensor is provided in a plastic bag attached behind the front panel in the UPS.

- 1. Remove the two screws from the cable inlet at the front and remove the cable inlet plate.
- 2. Guide the communication cable through the hole in the bottom plate and up through the cable inlet.
- 3. Guide the communication cable through the side panel hole and run the communication cable upwards inside the panel.
- 4. Pull the communication cable out of the side panel through the hole closest to the network management card area.
- 5. Plug the communication cable into the probe socket/PowerChute inlet.

6. Reattach the cable inlet plate.

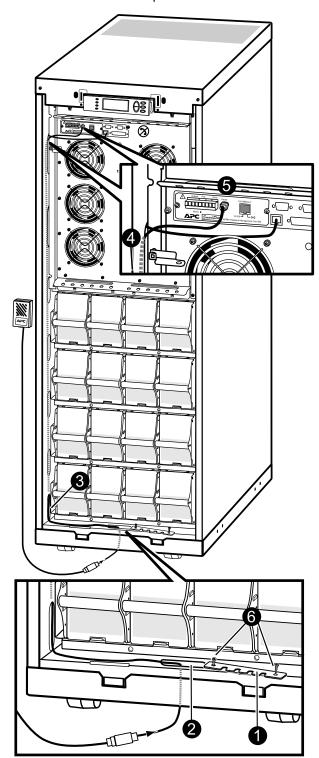

Connect Communication Cables in Parallel System

Overview of the PBus Cables


NOTE: The cables must be run by the electrician but not attached. The field service engineer from Schneider Electric will attach all cables to the UPS unit(s) and install the parallel communication box. The below is for overview only.

NOTE: The PBus cables are labelled PBus 1 and PBus 2.

NOTE: PBus 1 cables must be kept together, and PBus 2 cables must be kept together. If you by mistake run a cable between a PBUS1 terminal and a PBUS2 terminal, you will be notified by the display.

NOTE: All PBus cables must be installed with a ferrite (supplied).

NOTE: If the configuration consists of only two UPS units, the terminators must be installed in UPS 1 and 2. With three UPS units, the terminators must be installed in UPS 1 and 3.

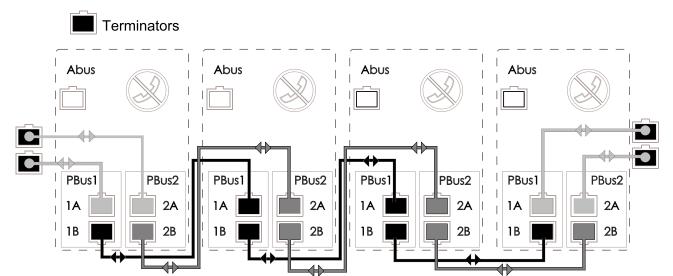

Prepare for Cables

Remove the Batteries

NOTE: See *Remove the Modular Batteries from the UPS Cabinet(s), page 21* for information on how to remove the modular batteries.


Run the Communication Cables

NOTE: The cabinets in a parallel system can be stand-alone cabinets, or they can be bayed together with interconnection plates. For stand-alone cabinets the communication cables can be run in conduits (if applicable).

There are three different ways of routing the communication cables:


- Stand-alone UPS cabinets (without conduits and without interconnection plates)
- UPS cabinets bayed together (without conduits and with interconnection plates)
- Stand-alone UPS cabinets and UPS cabinets bayed together (with conduits and optional interconnection plates)

Stand-Alone UPS Cabinets without Conduits and Interconnection Plates

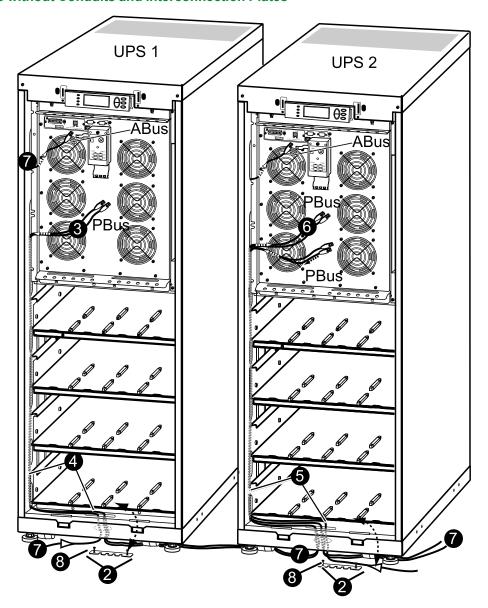

- 1. Remove the front panel (not shown).
- 2. Loosen the two screws from the cable inlet plates at the bottom plate of UPS 1 and UPS 2 and then remove the plates.
- 3. From UPS 1: Run the two PBus cables to the slots on the left side of the cabinet and down inside the panel.
- 4. From the lowest slot, fish out the cables from the side panel and run these down through the cable inlet and through the round hole at the bottom.
- 5. Run the PBus cables to UPS 2 and to the slots on the left side of the cabinet and up inside the panel.
- 6. Take out the PBus cables and leave these unattached to the parallel box.
- Run the ABus cable from the maintenance bypass panel to the slots on the left side of the cabinet and up inside the panel the same way as for the PBus cables.
- 8. Reattach the cable inlet covers.
- 9. Fasten the cables with cables ties.
- 10. If applicable: Route the PBus and ABus cables into UPS 3 and UPS 4 in the same way.

UPS Cabinets Bayed Together without Conduits

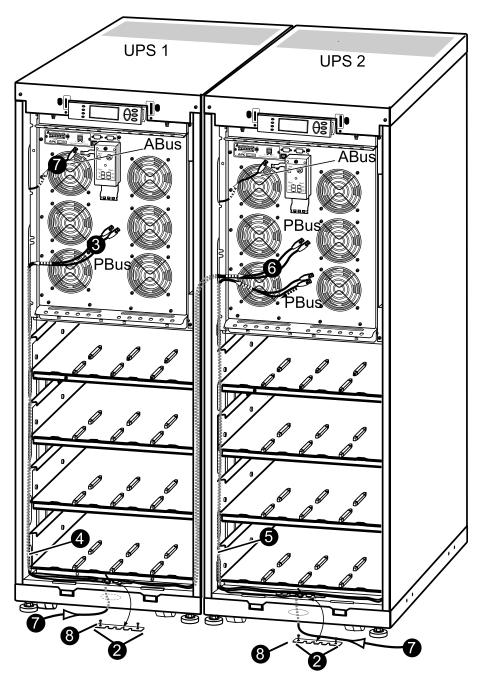

- 1. Remove the front panel and the top plate (not shown).
- 2. Loosen the two screws from the cable inlet plates at the bottom plate of UPS 1 and UPS 2 and then remove the plates.
- 3. From UPS 1: Run the two PBus cables to the slots on the left side of the cabinet and down inside the panel.
- 4. From the lowest slot, take out the cables from the side panel, run the cables across and through the cable inlets of the two side panels.
- 5. From the bottom of UPS 2, run the PBus cables to the slots on the left side of the cabinet and up inside the panel.
- 6. Take out the PBus cables and leave these unattached.
- 7. Run the ABus cable from the maintenance bypass panel to the slots on the left side of the cabinet and up inside the panel the same way as for the PBus cables.
- 8. Reattach the cable inlet cover plates.


- 9. Fasten the cables with cable ties.
- 10. If applicable: Route the PBus and ABus cables into UPS 3 and UPS 4 in the same way.

Stand-Alone UPS Cabinets or UPS Cabinets Bayed Together with Conduits

NOTE: When cabinets are assembled with interconnection plates and bolted together, the PBus cables can be run inside the cabinets and then only the ABus cable has to be run in a conduit (if applicable).


- 1. Remove the front panel (not shown).
- 2. Remove the top plate:
 - a. Loosen the six screws of the top plate (four in the front and two in the back).
 - b. Lift up from the back and push forward to free the plate.
 - c. Leave the plate unattached on top of the UPS.

Front and Rear View of the UPS

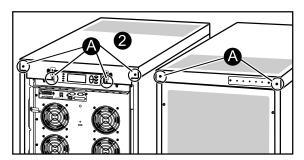

3. Remove the conduit plate at the back of the UPS top plate and drill holes centered in the small predrilled holes. 20 mm (3/4 in) is recommended for conduits.


Rear View of the Top Plate

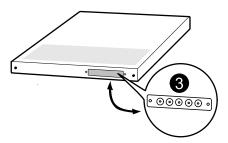

- 4. Run the ABus and the PBus cables through the conduit holes into the inside of the top plate on UPS 1. Leave the cables on top of the UPS.
- 5. Attach conduits with 20 mm (3/4 in) fittings (not supplied).
- 6. Run conduits with PBus cables to UPS 2. Pull the cables through the conduit plate on the top plate and leave the cables on top of the UPS as shown.
- 7. Attach conduits to UPS 2 with 20 mm (3/4 in) fittings (not supplied).

8. Run the ABus cables (in conduits if applicable) to the maintenance bypass panel.

Rear View of the UPS Cabinets

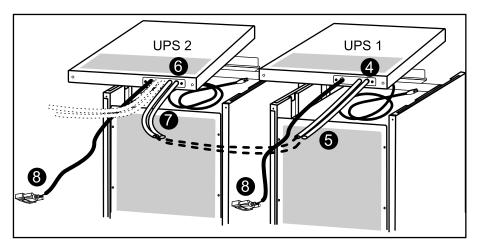

- 9. Reinstall the top plate.
- 10. If applicable: Route the PBus and ABus cables into UPS 3 and UPS 4 in the same way.

10-30 kVA 208/220 V Install Seismic Option


Install Seismic Option

Install the Seismic Battery Lock


NOTE: In seismic areas, dispose of the battery securing brackets that were used to secure the batteries during transport and use the seismic battery locks to secure the batteries.

Required parts:

- Four battery locks and 12 M5 screws for narrow battery cabinets.
- Six battery locks and 30 M5 screws for wide battery cabinets.

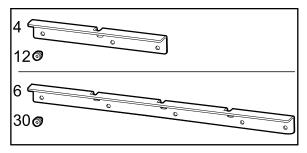

- 1. Place the battery lock below the battery row.
- 2. Secure the battery lock by the provided M5 screws.

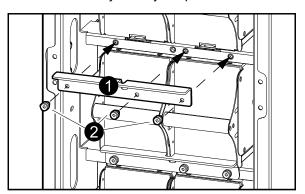


Install the Seismic Stabilizing Brackets


Required parts:

- · UPS, Battery cabinet and Transformer
 - Eight 10 mm fittings
 - 18 M6 nut washers
 - One horizontal bracket
 - Four stabilizing brackets
- Maintenance Bypass Panel (MBP)
 - Eight 2 mm fittings
 - 18 M6 nut washers
 - One horizontal bracket
 - Four stabilizing brackets

NOTE: When MBPs and transformer cabinets are installed up against other cabinets, it is sufficient to install only one cross with a horizontal bracket in top or lower position.




Install Seismic Option 10-30 kVA 208/220 V

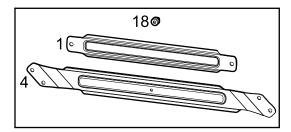

- 1. Insert pins of the fitting into the indicated mounting holes.
- 2. Mount the brackets in the fittings and secure.

Front view

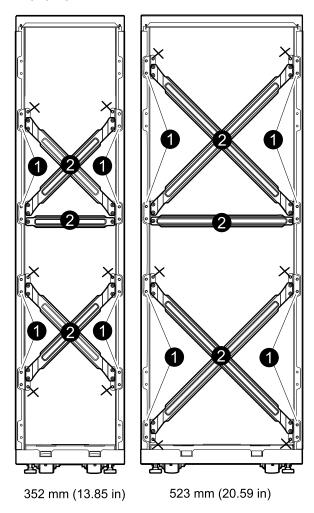

10-30 kVA 208/220 V Final Mechanical Installation

Final Mechanical Installation

Install Batteries and Connect Battery Securing Brackets

ACAUTION


RISK OF EQUIPMENT DAMAGE

- Wait until the system is ready to be powered up before installing batteries in the system. The time duration from battery installation until the UPS system is powered up must not exceed 72 hours or 3 days.
- Batteries must not be stored more than six months due to the requirement of recharging. If the UPS system remains de-energized for a long period, we recommend that you energize the UPS system for a period of 24 hours at least once every month. This charges the batteries, thus avoiding irreversible damage.

Failure to follow these instructions can result in injury or equipment damage.

NOTE: The battery securing brackets are only used in non-seismic areas for stability, and when seismic battery locks are not part of the installation.

Front view

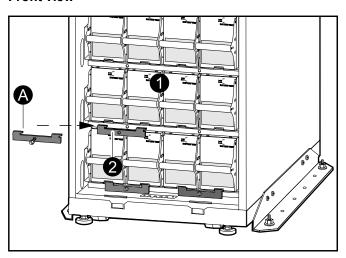


- 1. Install the batteries by pushing them all the way into the cabinet.
- 2. Optional: Rotate the battery securing brackets (A) 180° from how they were positioned on arrival and install them to hold the batteries firmly in place.

NOTE: Battery securing brackets are delivered with the UPS and modular battery cabinet and installed in front of the batteries. Battery securing brackets for additional batteries can be purchased. Refer to option SUVTOPT003: APC Smart-UPS VT Battery Lock Kit for one Battery Module (two batteries).

Final Mechanical Installation 10-30 kVA 208/220 V

Reinstall the Top Plate and the Front Panel

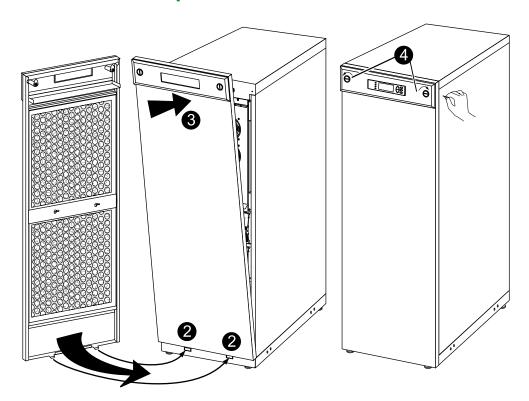

- 1. Reinstall the top plate by fastening the four screws at the front and the two screws at the back.
- 2. Insert the two taps at the bottom of the front panel into the two slots at the bottom of the cabinet.
- 3. Push the front panel forward until it engages the locking devices at the top of the cabinet.
- 4. Use a screwdriver to set the lock mechanism to the locked position.

Schneider Electric 35 rue Joseph Monier 92500 Rueil Malmaison France

+ 33 (0) 1 41 29 70 00

www.schneider-electric.com

As standards, specifications, and design change from time to time, please ask for confirmation of the information given in this publication.

© 2013 – 2017 Schneider Electric. All rights reserved.

990-1957G-001